



Subaru Impreza 2.0 L From model year 12.2000 With engine code EJ 201

Engine control lamp illuminates

If there are complaints about the above-mentioned fault, the cause could be the transmission idle switch. The following fault codes may be stored: P0301, P0302, P0303, P0304. These faults are stored if in the case of the respective cylinders several misfires are registered. In this case, a diagnostic tester should be used to check the misfires per cylinder. If, however, the ignition system is working perfectly, the transmission idle switch must be replaced (see illustration).

