



## **SUZUKI**

### **Grand Vitara**

**Year of manufacture: June 2005 - February 2007**

**Engine: Diesel**

#### **Faults in various systems Engine cable harness damaged**

**Problem:**

The engine cable harness can become damaged which could cause faults in various systems.

**Cause:**

Damage to the cable harness in the engine compartment could be due to the spigots protruding too far out of the engine cover. These can rub on the cable harness and cause faults on various electrical systems.

The vehicles specified above with the following vehicle identification number are affected:

JSAJTA44V 00100031 to 208945      and  
JSAJTD44V 00100054 to 223901

**Solution to the problem:**

Check the cable harness and, if necessary, repair and provide with a protector that can be purchased from a Suzuki authorised dealer.

**Bulletin**

