



VW Polo (6N2) ***All models up to model year 2002***

Engine will not start.

If there are complaints with these vehicles that the engine will not start, one possible cause is the ignition switch. In this case, contact problems on terminals 15 and 20 in the ignition switch occur. A further problem is poor guiding of the connection plug on the ignition switch. In order to eliminate the fault, a new, improved ignition switch must be fitted. It must be ensured that only switches after production date 0021 (day/day/day/year = 002 day in 2001) are fitted. The production date is printed on the ignition switch.

Bulletin

