



VW Polo (6N2) Up to model year 2002

Failure of the electric window winders.

If there are complaints with these vehicles that the electric window winder has failed, one possible cause is a defective window-winder motor. Due to excessive torque from the window-winder motor, the window pane jams at the end position, and the motor sticks. This leads to damage to the gears in the window-winder motor. In order to eliminate the fault, the window-winder motor must be replaced.

The new window-winder motors have a reduced torque and improved gears. The modified window-winder motors have been fitted as standard since March 2001 (from vehicle identification number: 6N1 265 908).

Bulletin

