



# Bulletin

## VW Tiguan All vehicles of model year 2009

### Engine continues running after ignition is switched off.

If complaints are made about these vehicles that the engine continues running even after the ignition has been switched off, a possible cause can be found with a defective relay 2 (engine control). The engine control unit - relay 2 is located in the fuse box / relay board (engine bay).

The relay is positioned in the fuse box as shown (See Figure 1 / Arrow).

It is possible that the fault code 00576 has been stored. This fault code refers to "supply voltage for drive circuit".

A modified relay is available to remedy this problem, with the following  
Spare part no.: 7 M0 951 253 A.

Please note: The relevant earth connections are also to be checked. Bad earth connections (varnish residues, corrosion etc.) can result in faults and malfunction or voltage problems in conjunction with the engine control unit.

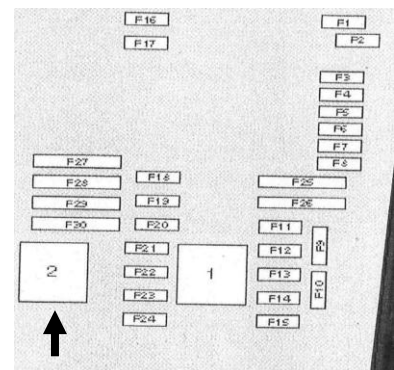


Figure 1