

© Hella KGaA Hueck & Co., Lippstadt

3. Mai 2002

- - 1

Audi A2, A4, A6, TT Malfunction of the electronic door lock

Due to water penetration, malfunctions of the electronic locking system are possible.

Because of water penetrating through the cable routing, the electronic door lock can become faulty causing a variety of malfunctions.

These malfunctions produce the following symtoms:

- The warning light "Door open" illuminates when the door is closed.
- The interrior lamp is functionless because of the missing control signal.
- The lock and release motor does not operate.
- The windows opened independently.

To solve the problem the door lock must be renewed. The latest door locks have a better seal and a reworked printed circuit board.

Bulletin

