



Opel various models

Fastening screw of the camshaft-sensor works loose

Vehicle:

- Corsa B 93 – 5/99
- Tigra 95 – 99
- Astra F 92 – 98
- Astra G 98 – 99
- Vectra B 96 – 98
- Zafira 99

Engines: 1,4 L und 1,6 L
Engine Code: X14XE, X16XE, X16XEL, C16XE

If the following complaints, e.g. increased full consumption, lack of engine performance and illumination of the engine warning light are noticed. The camshaft sensor can be the cause, due to too short a fastening screw and a low torque, tightness the sensor can come loose. There is no signal transfer, therefore the above mentioned symptom occur.

The solution is to use a longer screw (18 mm) which is secured with a screw locking device.

From engine number 20G98790 (Szenogthard) and 02JZ 9679 (Bochum) an 18 mm screw is used.

Bulletin

