



Renault Clio, Clio II, Twingo, Kangoo with engine D7F

Difficult starting or engine doesn't start

If the fault with this vehicle, with engine D7F (1,2 Lt. 40 – 44 KW) is difficult or not starting, a possible cause can be faulty injection valves. Due to changing fuel properties the injection valves could sieze up.

Check the injection valves, to see if they have a pink flange. If this is the case they must be replaced with injection valves with a violet flange Hella №. :8UW 009 087-721

A detailed list of the concerned vehicles appears below:



Vehicle	Type	from	till	Vehicle	Type	from	till	
Clio	357 K	F 000004	F 091465	Clio II	CB0 A	F 000001	F 101178	
		H 000001	H 003847			W 000001	W 072408	
		W 000001	W 056528			Y 000004	Y 050846	
		Y 000001	Y 065534			CB0 F	F 000002	F 008382
	357 Y	F 000002	F 000329		W 000001	W 000002		
	557 K	A 003435	A 004887		Y 011534	Y 019456		
		F 000000	F 088609		SB0 A	F 000001	F 000001	
		H 000001	H 008259		W 000002	W 003672		
		W 000001	W 074486		SB0 F	W 000001	W 000005	
		Y 000002	Y 069900					
	557 Y	F 000645	F 000667		Kangoo	FC0 A	U 000003	U 030078
	657 K	A 000017	A 005326			FC0 F	U 000001	U 000010
F 000001		F 021233	KC0 A	U 000003		U 057657		
Y 000003		Y 000827	KC0 F	U 000001		U 000010		
Clio II	BB0 A	F 000001	F 106039	Twingo	C06 6	F 000009	F 652024	
		W 000001	W 181264		W 000001	W 094189		
	Y 000048	Y 073318	C06 7		F 000001	F 079622		
	BB0 F	F 000002	F 005240		C06 8	F 000002	F 354125	
W 000001		W 000004	S06 6	F 000001	F 145263			
Y 000002		Y 012384	W 000007	W 001482				

Bulletin