



## *Alfa Romeo 147, all versions with side bags*


### Illumination of the airbag lamp

If the above mentioned fault is queried, the cause could be the plug of the airbag cable, fig. Changes of position, cause the plug contact to be put under load. Due to poor routing and insufficient fastening of the cable, the plug contact comes loose and the electrical contact is interrupted.

***Because it is an airbag system, the appropriate safety regulations have to be observed.***

In this case proceed as follows:

- Disconnect the earth/ground cable from the battery
- Separate the cable mounting from the lower part of the seat, by turning to the front and pulling away from the pivot
- The cable must be laid as in the picture and then fastened with cable fasteners

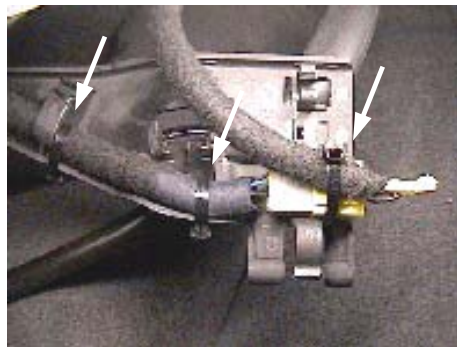

- Assemble the mounting in reverse order
- Repeat the same work for the second seat, too
- Connect the battery
- Read and delete any fault codes present