



Audi A6 (4B)

Fuse no. 14 burnt, central locking, window lift, seat heater, reading, footwell and interior lamps, anti-theft warning system, sliding roof, anti-theft warning system sporadically no function.

If there are complaints with these vehicles about the faults specified above, then a possible cause can be a damaged wire harness in the area of the front seats. Affected is the wire harness for the seat heater or the footwell lighting. The damage which leads to a short-circuit occurs in the area of the lumbar support and in the transition between seat and armrest.

To eliminate the fault, the damaged cables need to be repaired and chafing spots must be protected with adhesive felt. Any cable overlength must be installed in such a way that damage is prevented.

Bulletin