



## **BMW E39 Touring (estate)**

### **Faulty function of the rear windscreen wiper**

With this vehicle, the following faults can occur with the rear windscreen wiper:

1. When the engine is started with the rear windscreen wiper switched on, the wiper stops on the windscreen and cannot be used for approx. 10 minutes.
2. When the rear windscreen washing system is triggered there is no wiping function or the wiper moves once and then fails.

When the ignition is switched off/on again the wiper works normally again.

The reason for this fault can be a faulty rear windscreen wiper module. This is situated on the rear windscreen wiper motor (photo). To eliminate the fault, a new rear windscreen wiper motor must be installed.



Rear windscreen wiper motor with module