



## **Citroen Saxo With 1.4-litre engine (KFX)**

### **Engine misfires when cold/during the warming-up phase.**

If there are complaints with these vehicles that the engine misfires when cold or when in the warming-up phase, one possible cause is a software fault in the engine control unit. In most cases, the fault can be felt if the accelerator is depressed slowly. The engine control unit calculates an incorrect injection time.

In order to eliminate the fault, the software of the engine control unit must be replaced. In relation to this fault, there are no entries in the fault memory. A software update can be carried out at an authorized garage with the aid of OE diagnosis equipment and the latest software status.