



## ***Ford Fiesta With 1.25-litre Zetec-SE engine Model year 03.1997–07.1997***

### **Poor idling, increased engine speed.**

If there are complaints with these vehicles that the engine idles poorly, does not return to idling speed and that no engine braking effect takes place when driving with the throttle blade closed, one possible cause is a software problem in the engine control unit. In order to eliminate the fault, the software in the engine control unit must be updated by an authorized dealer.

#### **Note:**

1. If the software of the engine control unit has already been updated, this can be recognized by a yellow sticker with the update date on the engine control unit. The engine control unit is fitted in the front left footwell, on the A-pillar.
2. If it is necessary to update the software, it may be necessary in the case of vehicles with an immobilizer (PATS) to readapt the immobilizer to the engine control unit. To do this, all available vehicle keys are required.