



BULLETIN

Hyundai Getz Model year: 2002 to 2005 All models with 1.1 l engine

Engine is misfiring and rough idling.

If a customer complains about the above error, this could be caused by a dirty idle actuator. Due to oil carbon deposits on/in the idle actuator, the values of the engine control unit for idling regulation can no longer be set mechanically.

To rectify the error, the idle actuator can be treated with a suitable cleaning agent. In addition, components/units in this area (that can lead to the above-mentioned cause of error) must be inspected visually for the build-up of dirt (e.g. engine block ventilation, hoses, etc.).

If the units are very dirty, it is recommended that they are replaced, as damage can be caused during the cleaning process, and it is not guaranteed that the engine will run properly.