



Mercedes Benz A-Class (Type 168) Malfunction in the instrument cluster

Service display is not reset correctly following vehicle service

If there are complaints about the above-mentioned fault, the cause could be incorrect procedure during the resetting process.

Proceed as follows during resetting:

- Insert the key into the steering wheel lock
- Turn the key to position 2
- Immediately and within one second press the trip/total distance change button twice
- Turn the key to position 0
- Press the trip/total distance change button and keep it pressed
- Turn the key to position 2
- Keep the change button pressed (service display with current remaining mileage or time to next service will be displayed)
- Keep the change button pressed even after the signal tone has sounded (for at least 10 sec. or until the new start mileage is displayed)
- Now release the change button

Bulletin