



Mercedes Benz W 124, 129, 140, 202, 210 All models

Cruise control inoperative, engine regulates speed in gear position "D" too early, illumination of the bulb check when braking.

If there are complaints with these vehicles about the above-mentioned faults or further faults in other vehicle systems, the cause may be the installation of an aftermarket radio. Due to the installation of an aftermarket radio, the speed signal may suffer heavy interference. Before installing an aftermarket radio, the connection cable for the speed signal on plug A, pin 1 (green/white cable) should therefore be disconnected and insulated.

Bulletin

