



Mercedes-Benz Type 170 (SLK) 202 (C-Class) 208 (CLK) 210 (E-Class) with automatic transmission

Selector lever is blocked.

If there are complaints with these vehicle types that the selector lever cannot be moved from the park position (despite the brake pedal being pressed), one possible cause is the brake light switch. In this case the selector lever module does not receive a signal from the brake light switch. There is no fault stored in the fault memory of the selector lever module. To eliminate the fault the brake light switch has to be replaced. To do this proceed as follows:

- Remove the trim below the steering wheel.
- Disconnect the plug from the brake light switch.
- Turn the brake light switch and pull it out.

Installation:

- Pull the activating pin (1) of the brake light switch out completely.
- Press the brake pedal right down.
- Insert the brake light switch in the holder and turn until the catch (2) locks in place.
- Release the brake pedal. The activation path is set automatically.

