



Mercedes Benz W 170, 202, 203, 208, 210

Malfunction in the upper control panel of the centre console

If there are complaints about the above-mentioned fault, the cause could be a poor electrical contact in the control panel (see photo). The eleven-pole coupling of the switch assembly (S6/1) in the control panel cannot be contacted properly. This can result in the seat heating function, the interior locking function, the hazard warning light system and the switch illumination being inoperative. A rib running around the edge of the coupling means that the central locating lug on the seat heating control unit (N25/5) pushes in front of the coupling, and thus prevents the correct locking in place and secure contacting of the switch assembly.



In this case, remove the control panel. Following this, disconnect the coupling and cut the central locating lug off the seat heating control unit. Reconnect the coupling and refit the control panel. Check the switch for correct function.

Bulletin