



## **Mercedes Benz W 202 up to 30.09.1995 Only vehicles with „Moto-Meter“ instrument cluster**

### **Speedometer intermittently not working**

If there are complaints about the above-mentioned fault, the instrument cluster could be the cause. At high outside temperatures it is possible for the speedometer needle to "stick" on the stop pin and not come loose again until a speed of 40 km/h has been reached. In this case, a small rubber sleeve must be pushed over the pin.

Proceed as follows:

- Remove the instrument cluster
- Remove the glass housing
- Now push the sleeve over the stop pin. To do this, carefully turn the needle away from the pin
- Dampen a lint-free cloth with water and clean the needle where it touches the stop pin. Before assembling the glass housing make sure that there are no fingerprints or pieces of dust on the displays
- Refit the glass housing
- Install the instrument cluster
- Carry out a functional check

Bulletin