© Hella KGaA Hueck & Co., Lippstadt

24 May 2007

Mercedes Benz Vito (638) All models with ABS/ASR

Control lamp for ASR illuminates, stoplights do not work.

If there are complaints with these vehicles that the control lamp for the ASR system illuminates and that the stoplights have failed, one possible cause is a blown fuse. The fault code Stoplight switch Interruption of electrical circuit may be stored in the fault memory of the ABS/ASR control unit. In order to eliminate the fault, the fuse for the stoplight switch must be tested and, if necessary, replaced. The fuse is located in slot 5 of the fuse box on the steering column (vehicle-specific details must be observed).

Bulletin





1-1