



Mercedes Benz With 104.942, 104.992, 111.960 engine

ABS or ABS/ASR warning light illuminates permanently or sporadically.

If there are complaints with these vehicles that the ABS or ABS/ASR warning light does not go out after starting the engine or illuminates sporadically during a journey, one possible cause is a loose connection in the overvoltage protection relay. The loose connection occurs in the plug-in area for the 15 A fuse on the relay. The fault can be reproduced by waggling the fuse when the engine is running. To eliminate the fault, the overvoltage protection relay must be replaced.

The relay is fitted on the right-hand side of the vehicle in the area of the control units (see photo).

