



Opel Meriva all models built 2003-2004

Warning light comes on, fault code C0040 is stored.

If there are complaints with these vehicles that the ABS warning light comes on and sometimes the fault code C0040 is stored in the ABS control unit, one possible cause can be oxidation between the control unit connector and the control unit itself. This fault is caused by humidity penetration. Water runs onto the ground connection point situated below two cut-outs in the left-hand wing. The humidity reaches the ABS control unit connector via the ground cable. If there are complaints, the two cut-outs in the wing have to be sealed using adhesive film. The control unit connector and the control unit can be cleaned depending on the degree of soiling. In extreme cases the cable harness and control unit have to be replaced.

Bulletin

