



## ***Opel Omega-B***

### **ABS lamp illuminates, fault code 33 in the ABS control unit**

If there are complaints with these vehicles that the ABS lamp illuminates and fault code 33 is stored in the control unit, one possible cause is a faulty ground connection. The ground connection of the control unit is affected. This ground connection is produced by the control unit attachment screws on the hydraulic unit.

To eliminate the fault, the attachment screws must be removed and the thread and the screws must be cleaned. After this, the fault memory must be deleted and the system must be checked to make sure that it is working perfectly.

**Bulletin**

