



Opel Omega B All models

ABS warning lamp illuminates.

If there are complaints with these vehicles that the ABS warning lamp illuminates and that fault codes 31, 37, 43, 47, 65, 66, 67, 78 are stored in the fault memory, the cause may be a cable break or corrosion in the control-unit plug. In the case of a possible cable break, pins 45 and 46 of plug X are affected. This is located in the front-left footwell. In the event of a complaint, both plug X and the control-unit plug should be checked and repaired. After the repair, the fault memory must be deleted.

Bulletin

