



Opel Vectra-C, Signum Model year 2003 to 2005 Engine code Y30D

Engine goes into limp-home mode

If there are complaints about the above-mentioned fault, the cause could be a blocked ventilation hole. In addition, fault code P0105 (intake pressure sensor/atmospheric pressure sensor circuit malfunction) may be stored. This ventilation hole is a part of the ventilation cap, which is located on the engine control unit.

Due to the blocked ventilation, the atmospheric pressure sensor, which is located in the control unit, can no longer carry out correct measurements, and the engine goes into limp-home mode. In this case, the grey ventilation cap must be replaced. Before the new cap is fitted, it must be ensured that the area around the cap is cleaned so that no contaminants get into the control unit.

Bulletin