




Opel Vectra B Model year 1999 - 2002

Airbag warning lamp illuminates.

If there are complaints with this vehicle that the airbag warning illuminates, one possible cause could be a problem with the side airbag sensor. This problem can be caused by a mobile phone being stored in the door pocket. To eliminate the fault, a read-out of the fault memory must be taken to localise which door is affected. Insulation must then be attached to the inside of the door trim panel.

To do this proceed as follows:

- Remove the door trim panel.
- Attach insulation in 3 strips (each overlapping by approx. 2 mm) at the spot marked (see illustration).
- Refit the door trim panel.
- Delete the fault memory and make sure the airbag warning lamp has gone out.

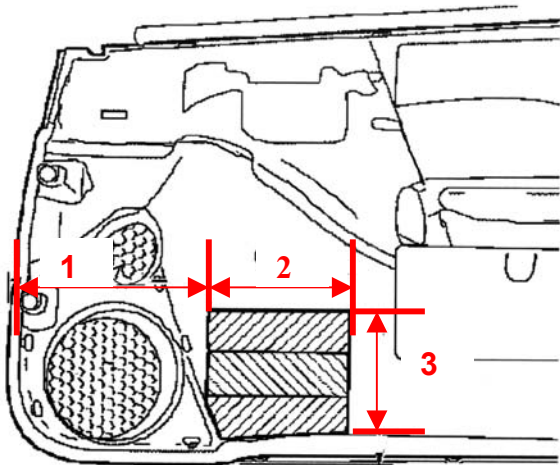

1 = 240 mm
2 = 150 mm
3 = 170 mm

Inside view of the door trim panel