



## **Opel Vectra-C Model year 2002 All engines**

### **ESP control lamp illuminates**

If there are complaints about the above-mentioned fault, the cause could be a defective steering-column module. Furthermore, failure of the steering-angle sensor occurs. Due to this, the control lamp for the electro-hydraulic steering also illuminates in the display of the revolution counter. In addition, the automatic indicator reset does not work. Under certain circumstances, fault codes B1012 and B1020 may also be stored. In this case, a steering-column module with a new software status must be fitted. Such modules are marked with a blue dot. The new modules are equipped with software status OP94/12.

**Bulletin**

