



Peugeot 206 With electrically-folding outside mirrors

Fuse blown, electrically-folding outside mirrors and rear window- winders not working, battery control- lamp stays on.

If there are complaints with these vehicles about the above-mentioned faults, one possible cause is a leaky folding motor in the outside mirror. Water penetration gives rise to short-circuits in the folding motor. In order to eliminate the fault, the cables to the outside mirror in the door must be checked and, if necessary, repaired and the outside mirror replaced. Fuse no. 22 in the fuse box (interior) must also be replaced.

Bulletin

