



Peugeot 307

All models with electro-hydraulic power steering

Power steering stiff after accident repairs.

If there are complaints with this vehicle that the electro-hydraulic power steering only works to a limited extent following accident repairs, one possible cause is the control unit for the steering system. If this control unit determines during an accident that the mass acceleration is around 1g, it switches to accident safety mode. This reduces steering support to a minimum. To eliminate the fault, a suitable diagnosis unit must be used to read out the fault memory. If there are no faults stored in the fault memory or if these are deleted after repairs, the control unit switches back to normal mode through an automatic "reset". Perfect function is then guaranteed again.

Bulletin

