



Peugeot

106, model year from 01.1997-12.1998

306, model year from 01.1996-12.1998

406, model year from 01.1995-12.1998

Airbag warning light illuminates

If there are complaints about the above fault, the cause could be poor contact between the multi-connectors in the wiring harness for the seat belt tensioner. These are each located under the front seats.

In this case proceed as follows:

- Remove the multi-connector from the seat belt tensioner wiring harness.
- Strip the insulation from the cable ends.
- Connect the cable ends with the aid of self soldering joints (Hella part number 8KW 744 888-003).
- Wrap insulating tape around the wiring harness and fix with the aid of cable ties.
- Delete the fault memory.