



Renault Megane and Scenic All vehicles with ESP

ESP warning light illuminates

If there are complaints about the above fault, the cause could be the battery voltage being too low when the engine is started. In addition, the fault code "steering angle sensor" is stored. In this case, proceed as follows.

- Remove the fuse box from the lower instrument carrier.
- Remove fuses F16 and F26 from the fuse carrier.
- With the aid of a shunt connector, connect the two slots together (see Fig. 1).
- Connect the fuses on the shunt connector.
- Refit the fuse box.
- Delete the fault memory.

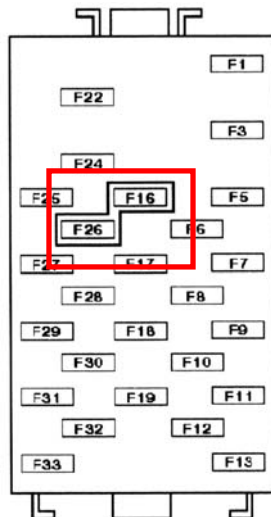


Fig. 1

Bulletin