



Saab 9-3

All vehicles with petrol engines

Model year 1998 to VIN W2061707

Model year 1999 to VIN X2005838

Engine has no power

If there are complaints about the above-mentioned fault, the cause could be incorrectly laid connection hoses on the activated carbon filter. In addition, there may be complaints about:

- vibrations during the acceleration phase
- the engine cutting out
- poor engine starting.

In addition, fault code P0172 (mixture too rich, cylinder bank 1) may be stored.

Due to faulty installation, the hoses can kink, and flow problems arise. In this case, the laying of the hoses of the activated carbon filter system must be checked and, if necessary, re-laid or replaced.

