## **Bulletin**



© Hella KGaA Hueck & Co., Lippstadt


1 August 2007

ust 2007 1-1

## Saab 9-3 Hatchback, model year 2000 until vehicle identification no.: Y2018486 Convertible, model year 2000 until vehicle identification no: Y7006098

## Poor engine running / Restricted ride comfort

If there are complaints about the above-mentioned fault, the cause could be a defective hose piece. The angled hose (see illustration) on the T-piece, from the activated-carbon-filter solenoid valve (activated-carbon-filter canister purge valve) to the intake manifold, becomes brittle due to operational influences. In this case, the hose must be removed from the retaining clip and checked and, if necessary, replaced. The improved hose design is marked with a dotting-mark, directly next to the part number, on the thick end of the hose.

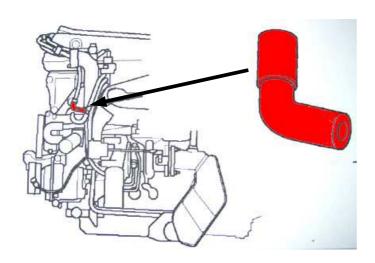

## Bulletin

