



Toyota

Toyota RAV 4

Model years: 2006 to 2009

Safety belt warning buzzer

Safety belt warning light

If there are complaints for these vehicles that

- with unoccupied front passenger seat -
- with empty front passenger seat -

the safety belt warning light and buzzer are activated, a possible cause is a high sensitivity to the passenger seat occupancy sensor (seat occupancy sensor for the front passenger seat).

Note on corrective action:

- Install revised front passenger seat occupancy sensor (seat occupancy sensor for the front passenger seat).

Spare part:

- Seat occupancy sensor - right-hand steering:
 - 1 unit Spare part no.: 71052-42061
- Seat occupancy sensor - left-hand steering:
 - 1 unit Spare part no.: 71051-42041