



# BULLETIN

---

**Vauxhall**

**Vivaro**

**Model year: 2011–2013**

**Chassis no.: BV600001 – DV602062**

**Engine code: M9R-630**

**The engine warning light illuminates.**

On the vehicle specified above, a complaint has been made that the engine warning light illuminates when traveling downhill over longer distances.

In addition, error codes P0201, P0202, P0203 and P0204 (synonymous with: injection valve / nozzle 1-4, power circuit malfunction) are stored in the engine control unit.

The cause could be a faulty calibration of the engine control unit.

The vehicle manufacturer has already addressed the issue.

A software update is available from CW 5 / 2013.

A changed software shall be used in the production from November 26, 2012 and chassis number WOLF7B1AEDV602062.