

© Hella KGaA Hueck & Co., Lippstadt

10. September 2001

I_1

Ford Transit, build since 08.95 - 12.97

Temporary or total loss of the side lamps or panel lamp

To rectify the problem:

Renew the light switch plug

- 1. Disconnect battery
- 2. Remove steering column trim
- 3. Disconnect plug from the light switch, partially remove some insulation from the wiring harness
- 4. Cut the cables approx. 4 cm behind the plug
- 5. Cut the loom cables to custom-fit the new plug, remove insulation
- 6. Fit the new plug with solder-/ crimp connections
- 7. Connect the plug to the light switch
- 8. Refit the steering column trim, reconnect battery





