



Audi

A6 (4B...)

All models without xenon headlights

Fault lamp for headlight range adjustment illuminates.

The fault lamp for headlight range adjustment is fitted as standard in all instrument clusters of this vehicle model. However, it is connected only in the case of vehicles with xenon headlights. If the fault lamp illuminates on vehicles without xenon headlights, the cause is an unfavourable circuit in the instrument cluster. In order to eliminate the fault, pin 32 on the green connector plug of the instrument cluster must be wired to terminal 15. This results in the fault lamp for the headlight range adjustment being switched off permanently.