



BMW E 34 Model year 09/1995 – 02/1996 with Check Control

Sporadic error message “dipped beam” or “number plate light” in the Check Control display.

If there are complaints with these vehicles that the error message “dipped beam” or “number plate lamp” appears sporadically in the Check Control display even though the vehicle is OK, one possible cause could be the headlamp levelling actuators. To rectify the fault, the headlamp levelling actuators on vehicles manufactured during the period stated must be replaced.

Note:

Headlamp levelling actuators which have a white dot do not need to be replaced. In this instance the cause of the fault lies elsewhere.

Hella part number for the headlamp levelling actuators:
6NM 004 375-311