



Fiat Punto II, Typ (188)

Condensed water in the headlamp

If the above mentioned failure is queried, the cause could be bad ventilation inside the headlamp. This can be recognized by, condensation collecting inside the head lamp and runs as waterdrops down the lens. In this case on both headlamps the bulb cover and the fastening clamps must be replaced. Retrofit sets are available (with and without fog light). These contain revised covers with ventilation holes and the corresponding clamps.



Before installation, any visible condensation should be removed with a hair-dryer. Pay attention when mounting the new cover, that the ventil points downwards.

Bulletin