



## VW Golf V

### LED – tail light/hazard warning light without function

If there are complaints with above-mentioned vehicle models equipped with the Hella LED tail light 2VP 009 500-801 (silver/red, see Fig. 1), that the hazard warning light does not work, the problem could be caused by a modified onboard electronics system. In some cases, when the engine is switched off and the hazard warning light activated, the function of the hazard warning light is not guaranteed. From model year 2006 (week 22, 2005), the onboard electronics of the Golf V were changed by the vehicle manufacturer. Modified sets are expected to be available from week 17/06. The following regulation applies for vehicles which already have these lights fitted:



Fig. 1

- The problem does not occur with vehicles built before week 22/2005. The date of manufacture is on the rear of the light (see Fig. 2).
- From model year 2006 (with roof aerial) the LED lights will be replaced free of charge by the modified version if complaints are received from customers.

The version 2VP 009 500-831 (silver/black) will be delivered from SOP in week 17/06 with the updated LED-PCB.

Fig. 2

