



Mercedes Benz Vito

Flickering interior lamps

If there are complaints about the above-mentioned fault, the cause could be contact between the fixing screw of the roof strip, or the blind screw of the roof frame, and the contact connection of the rear interior lamp.

In this case proceed as follows:

- Remove the rear right and left interior lamps (between C-pillar and D-pillar).

Vehicles with roof rails:

- Remove the blind screw via the rear interior lamps and shorten it by 5 mm.

Vehicles with roof strips (C-rail):

- Remove the fixing screw via the rear interior lamps and shorten it by 5 mm.
- Following this, fasten the screws again and install the interior lamps.

Bulletin