



VW Sharan ***All vehicles from model year 02.2001*** ***and vehicle identification no.*** ***7M1 Y 052 861***

Cloudy headlights

If there are complaints about the above-mentioned fault, the cause could be paint vapours. The high temperatures in the headlight partly lead to the paint peeling from the bulb shields and settling as a “milky” deposit in the upper third of the headlight. This situation arises particularly in the case of high-mileage vehicles, the headlights of which are in use for several hours at a time. In this case, the headlight must be replaced.

Bulletin

