



## VW, Audi, Seat, Skoda: insufficient headlamp range and headlamps dazzle

Data sheet	
Manufacturer	VW   Audi   Seat   Skoda
Vehicle model	Various models
Symptom	Insufficient headlamp range, headlamps dazzle

### Important safety note

## VW, Audi, Seat, Skoda: insufficient headlamp range or poor illumination of the road after H7 bulb replacement


After the main headlamp bulbs have been changed on the vehicles mentioned above, there may be insufficient illumination of the road or oncoming traffic may be dazzled. This is especially true when using H7 bulbs. There are two reasons for this. Either the headlamp's bulb socket allows different mounting positions or the bulb has not been correctly inserted (twisted) during mounting. This leads to uncontrolled scattering of the light ([Fig. 1](#)).

Therefore, checking that the bulb is installed correctly is strongly recommended after every bulb replacement. The light pattern can be checked using a headlamp tester. [Figure 2](#) shows that the installation has been done correctly. Here, the light/dark boundary and also the asymmetric angle are clearly visible.

This information may certainly also apply to vehicles from other manufacturers.



Figure 1: uncontrolled scattering of light

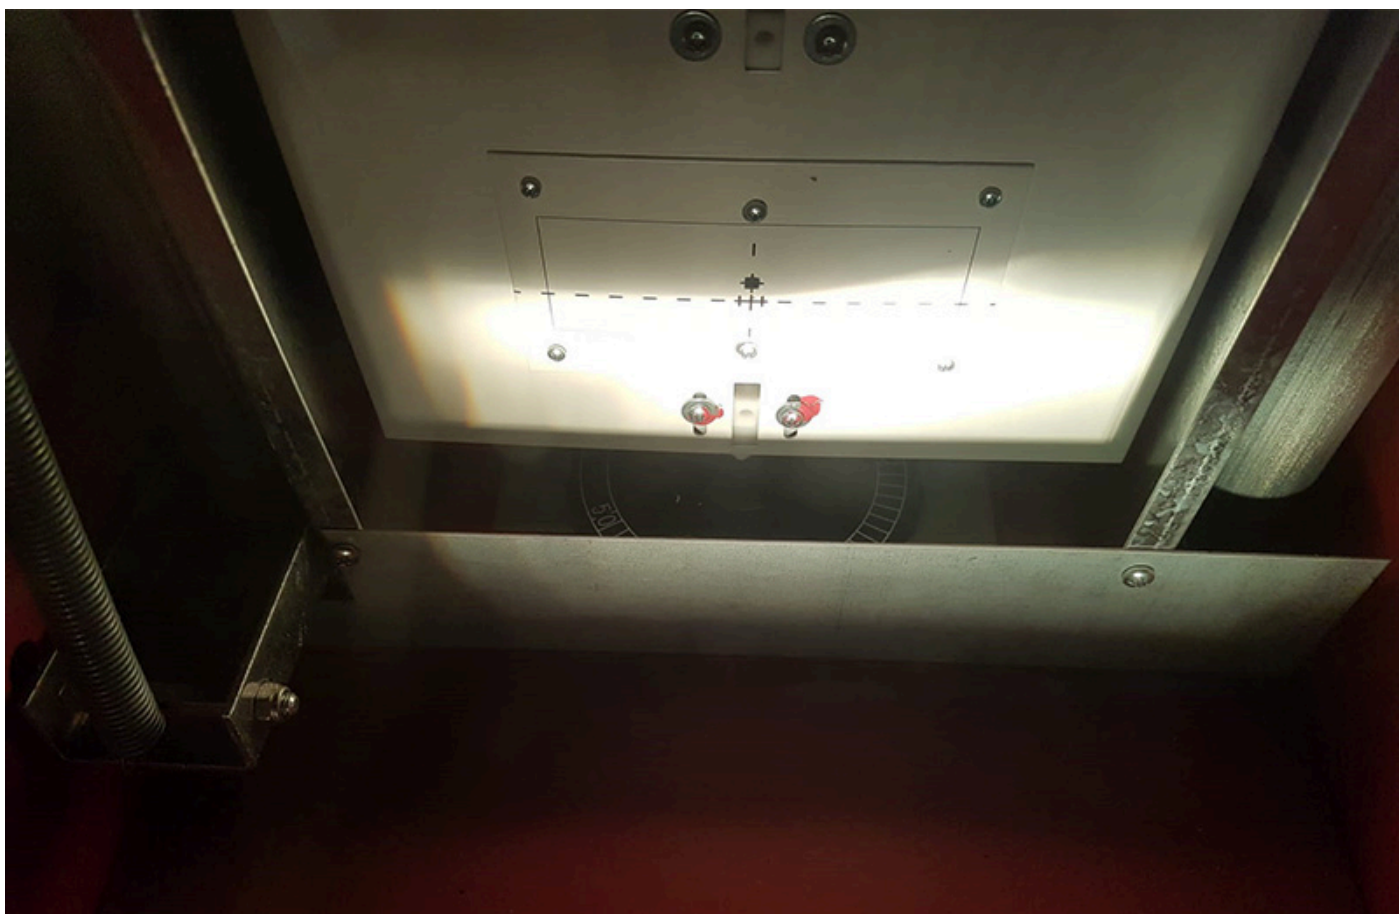

## Figure 2: Light/dark boundary and asymmetric angle clearly visible

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.