Opel Corsa B - Engine jerking while driving, irregular idling | HELLA

Opel

Opel Corsa B

Engine code: X12XE (1997 to 2000)


Engine jerking while driving, irregular idling.

If there are complaints about the problems mentioned above, the problems could be caused by a defective idle speed control/idle actuator (Figure 2).


The following complaints may be encountered:

- Varying idle speed (+/- 100 rpm).
- Engine jerks while idling.
- Engine does not accelerate properly.
- Engine jerks when accelerator pedal is released.

Under certain circumstances the engine warning light (Figure 1) will also turn on and the fault code P0505 may be stored (Figure 3). Screenshot: Diagnosis with Hella-Gutmann_mega macs

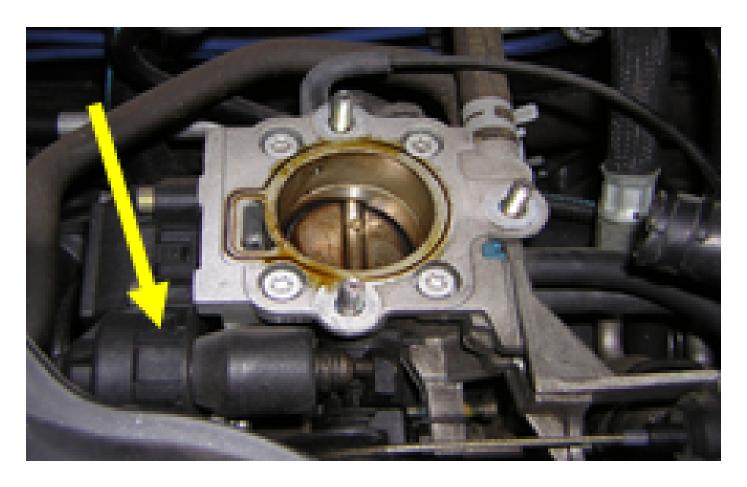



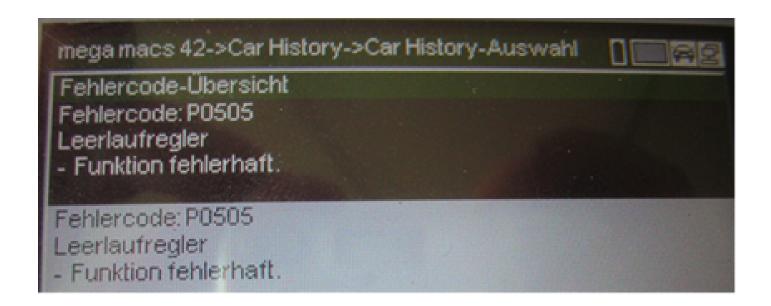

Important safety note

The following technical information and tips for practical use have been set up by HELLA in order to offer professional support to automotive workshops in their daily work. The information available here on this website is only to be used by appropriately trained specialist staff.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.