


Mondeo, build 01.95 – 01.98

Speedometer temporary malfunction
or non function, automatic
transmission does not engage 4 th
gear.

To rectify the problem:

The cause of the problem is a broken drive shaft of the
vehicle speed sensor or a faulty wiring of the sensor.

1. Renew the vehicle speed sensor
2. Relay the wiring and secure it with cable ties

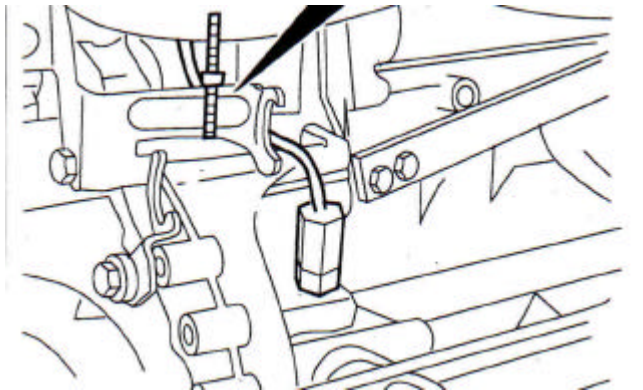

Best Regards
Your Service Partner Technical Team

Bulletin

