



# Fiat Punto 199: engine stalls, engine does not start

Data sheet	
Manufacturer	Fiat
Vehicle model	Punto 199
Engine	1.2i 8-valve engine
Year of manufacture	2014 – 2018
Symptom	Engine stalls or engine does not start

## Important safety note

## Fiat Punto 199: engine stalls, engine does not start

In the vehicles mentioned above, a broken cable in the engine wiring harness can cause the engine not to start or to stop while driving.

To remedy this, the wiring harness leading from the engine control unit to the ignition coil or to the injection valves should be checked (Fig. 1). The insulation must be removed for this purpose. The shrink sleeves should be paid particular attention. Vibration can cause the cables to break at this point (Fig. 2).

## IMPORTANT

The error memory may contain various error codes that relate to the ignition or injection valves. The error often occurs sporadically.

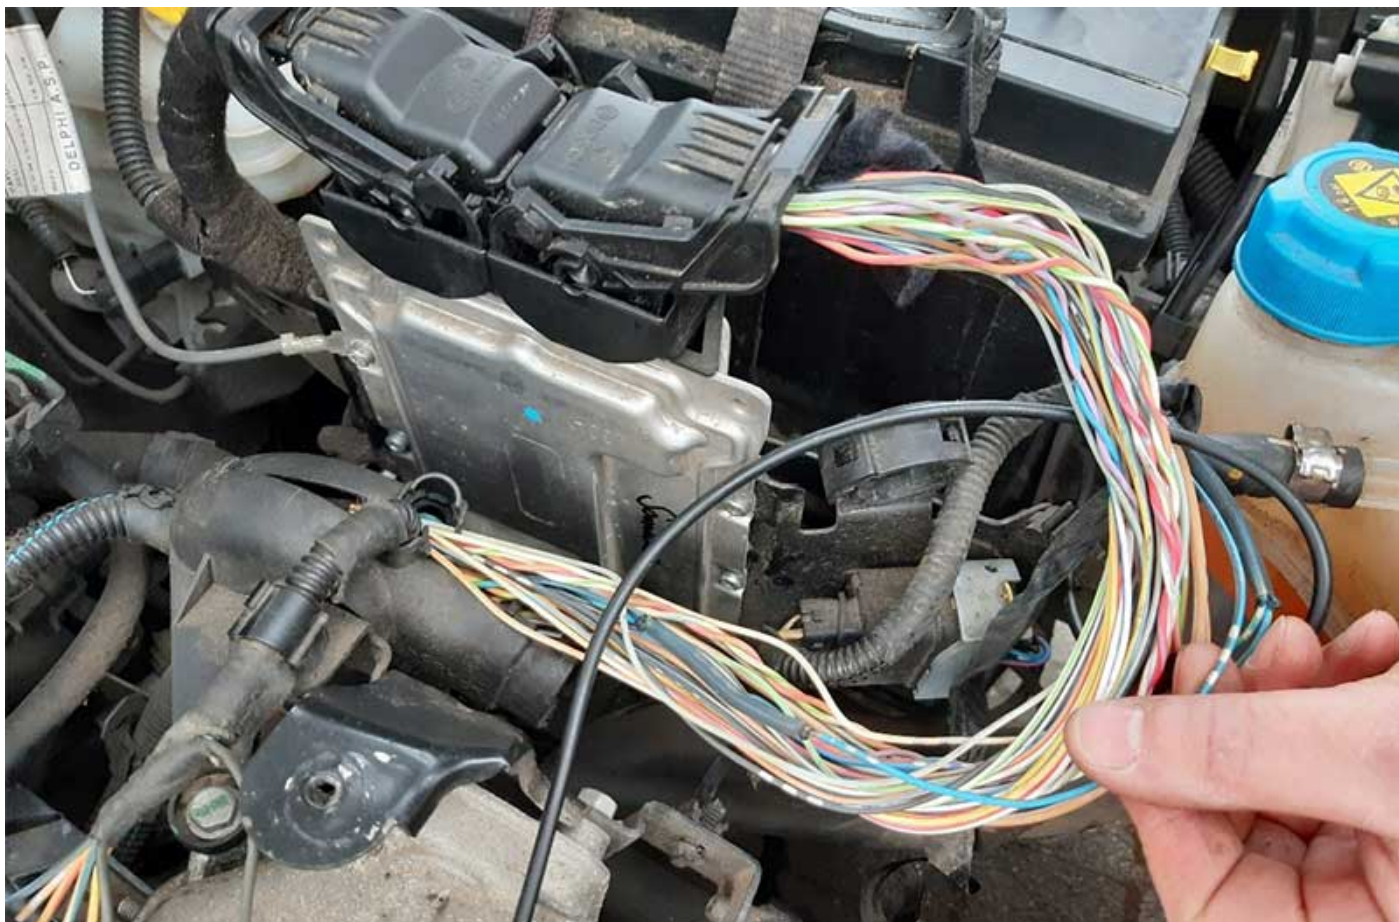


Figure 1: Check the wiring harness leading from the engine control unit to the ignition coil or to the injection valves

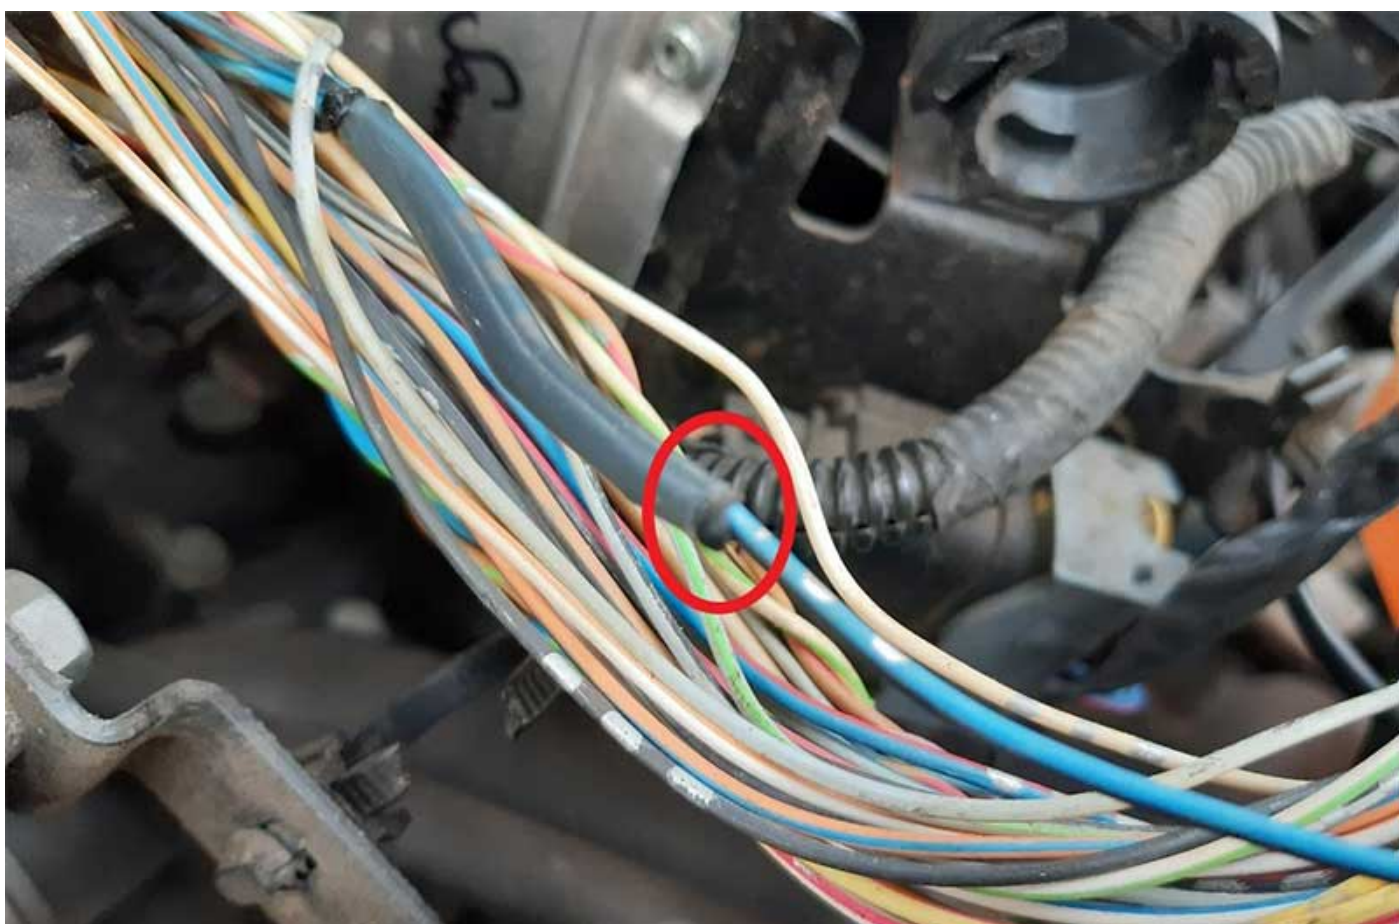


Figure 2: Vibration can cause the cables to break at certain points

## **THIS MAY ALSO BE OF INTEREST TO YOU**

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.