



# Citroën Relay - interior lamp is permanently on


Data sheet	
Manufacturer	Citroën
Vehicle model	Relay
Year of manufacture	2006 - 2014
Please note	All models with sliding door
Symptoms	Interior lamp is permanently on

## Important safety information

## Citroën Relay - interior lamp is permanently on

If the above-mentioned defect is detected, this malfunction can be seen in connection with the contact pin of the sliding door. In addition, the door ajar warning lamp in the instrument panel may be activated. Furthermore, the central locking system is partially out of order. In such a case, you should proceed as follows:

- Check correct installation position of the contact plate
- Check the position or setting of the stop pin and of the contact pin (Fig. 1).
- Check the switching function of the contact pin;
- if necessary, remove the contact plate and adjust the stop pin to the required installation depth.

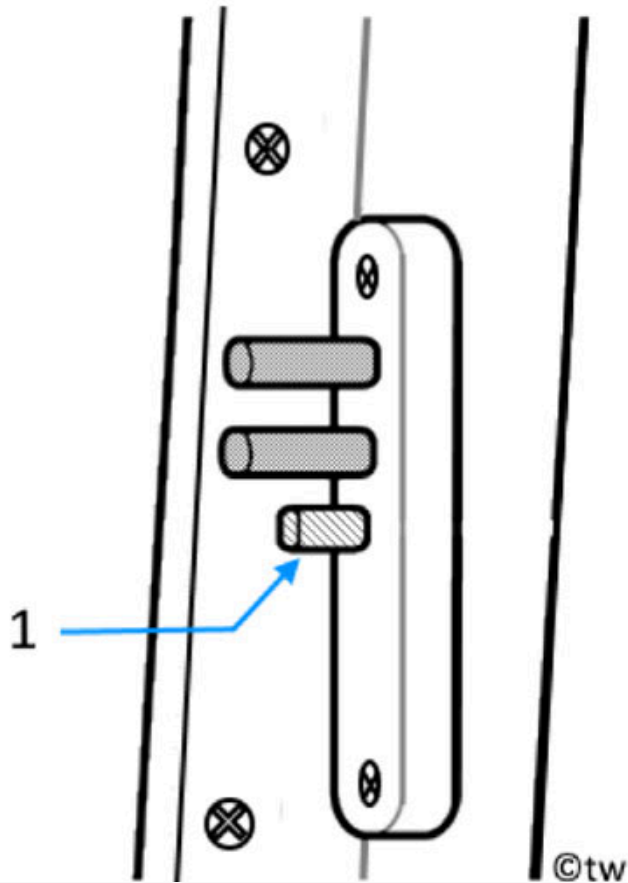

Citroën Relay - interior lamp is permanently on

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.