

# **Fiat Scudo - Poor air conditioning system performance | HELLA**

**Fiat**


**Scudo 1.6D Multijet 90**

**Year of manufacture: from 2007 until VIN 84160387**

Poor air conditioning system performance

If the vehicles mentioned above experience poor air conditioning performance or a loss of coolant, the possibility of a coolant leakage between the condenser and compressor must be considered.

Check the coolant line for the correct model type and replace if necessary. (see figures)

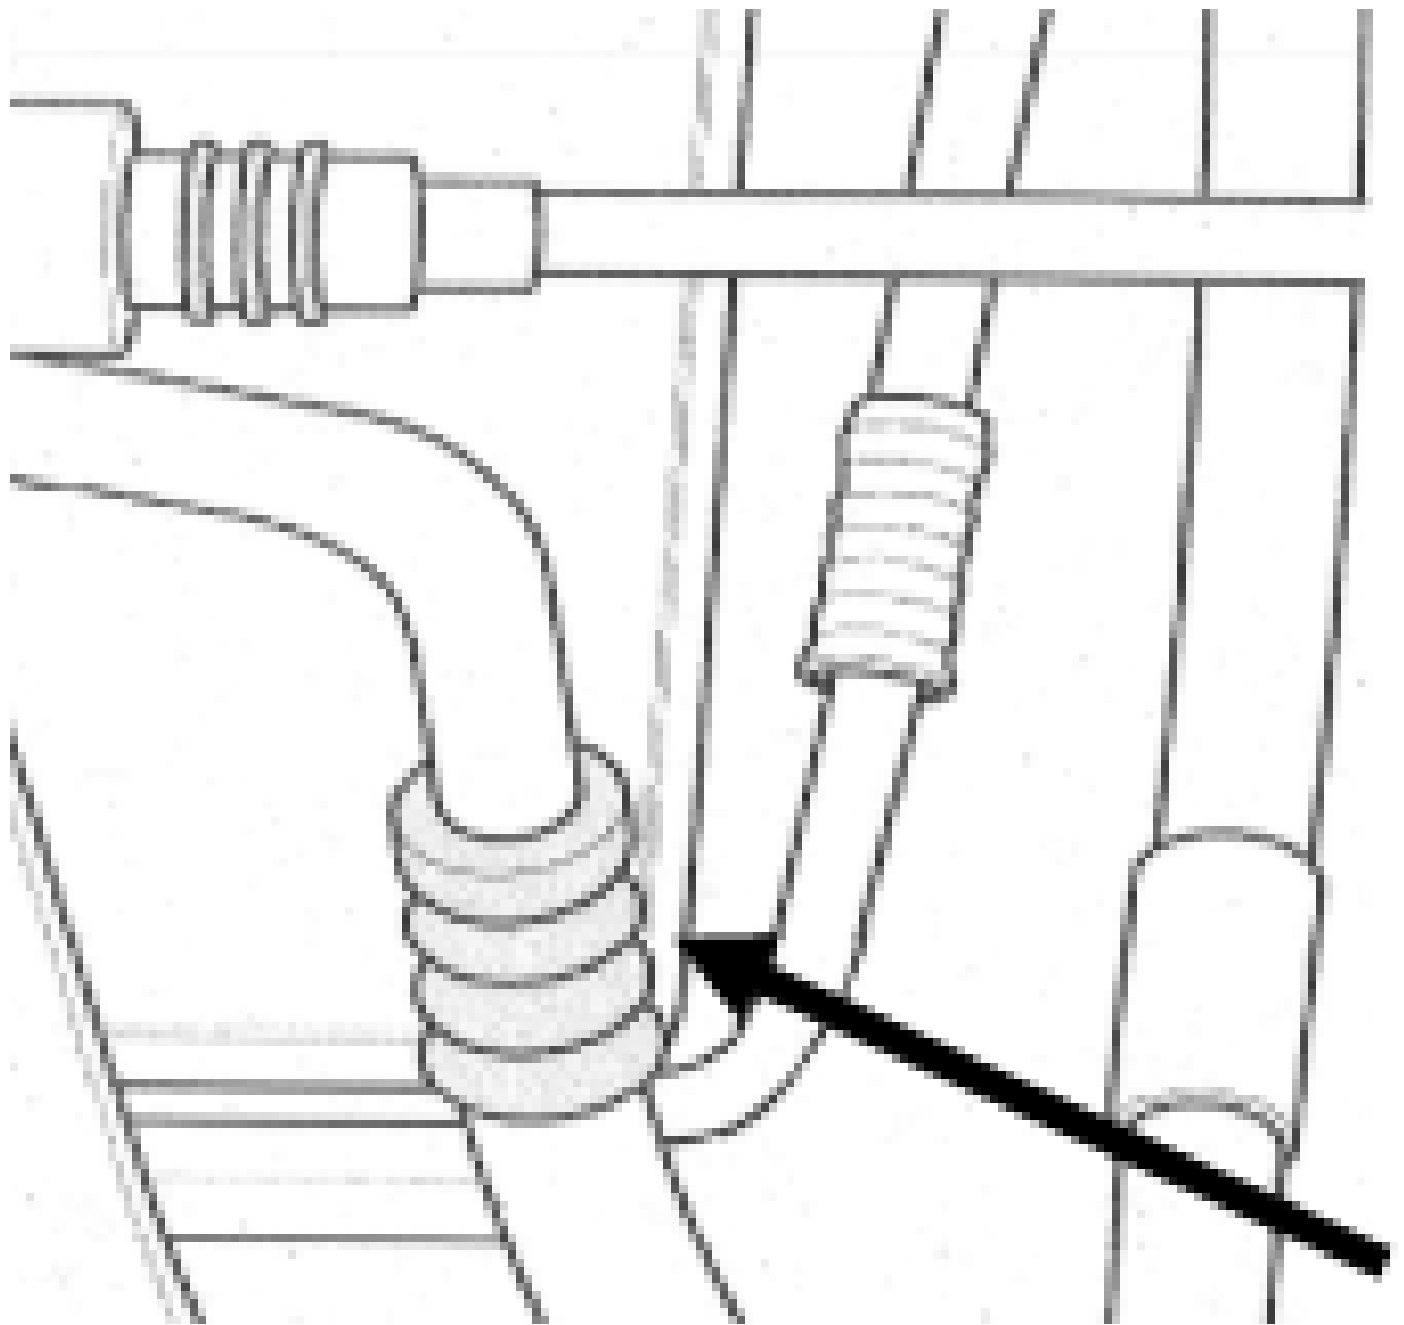




- Old model types -

This is the modified model type from the vehicle manufacturer: [Spare parts]

- 1 unit: Coolant line: (Spare parts): 140142280

- 2 units: O-ring: (Spare parts): 9645950980

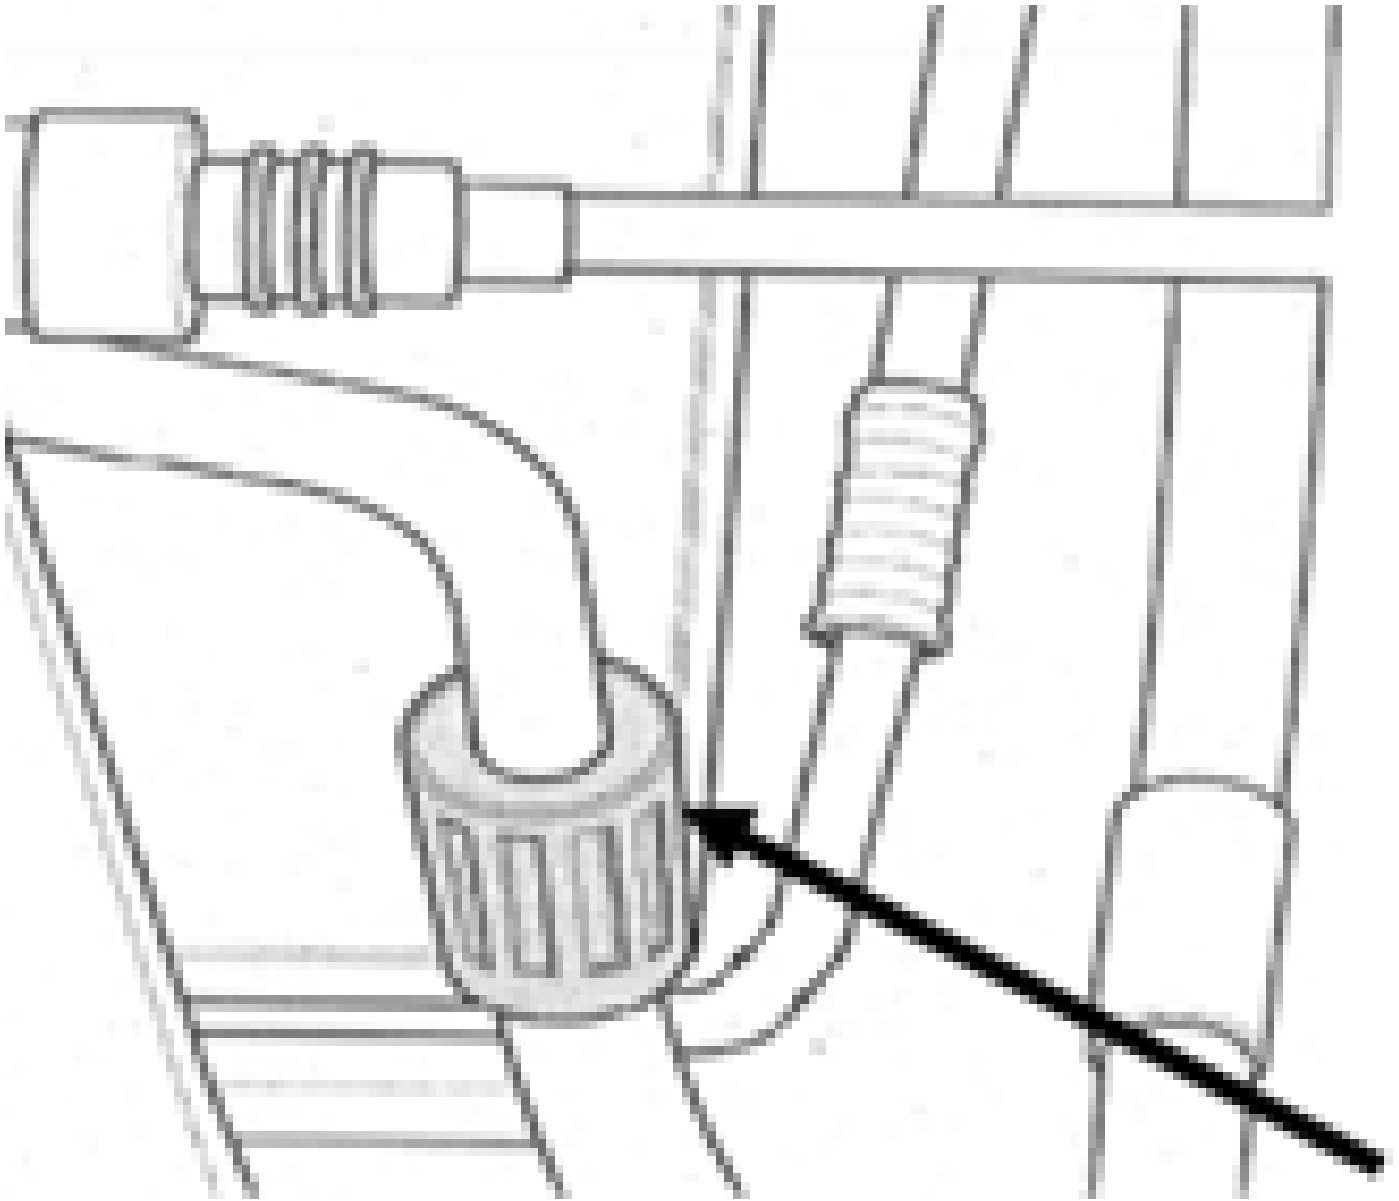

### **ⓘ Important safety note**

The following technical information and tips for practical use have been set up by HELLA in order to offer professional support to automotive workshops in their daily work. The information available here on this website is only to be used by appropriately trained specialist staff.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.