



# VW Polo V (6R/6C) - replacement of light source for halogen headlamps

Data sheet	
Manufacturer	VW
Vehicle model	Polo V (6R/6C)
Year of manufacture	2009 - 2017
Symptoms	Replacement of light source for halogen headlamps


## Important safety note

## Bulb replacement H7

On the above-mentioned vehicles, bulbs for halogen headlamps can be replaced as follows:

- Switch off the ignition
- Disconnect the headlamp from the power supply by unplugging the electrical supply line
- Loosen and remove the two fastening screws [\(Fig. 1\)](#) (for a more convenient removal of the headlamp, a part of the lock support can also be dismantled by removing all 6 screws)
- Carefully pull out the headlamp towards the front (in the direction of travel), taking care not to damage the paint on the bumper
- Access the bulb by removing the protective cap at the back
- Hold the bulb fitting with 2 fingers and turn it anticlockwise [\(Fig. 2\)](#)
- Take out bulb
- Remove bulb from fitting [\(Fig. 3\)](#)
- Place new bulb into the fitting. Important: Do not touch the glass section of the bulb!
- Refit the bulb and headlamp in reverse order

- Check functioning
- Check headlamp setting

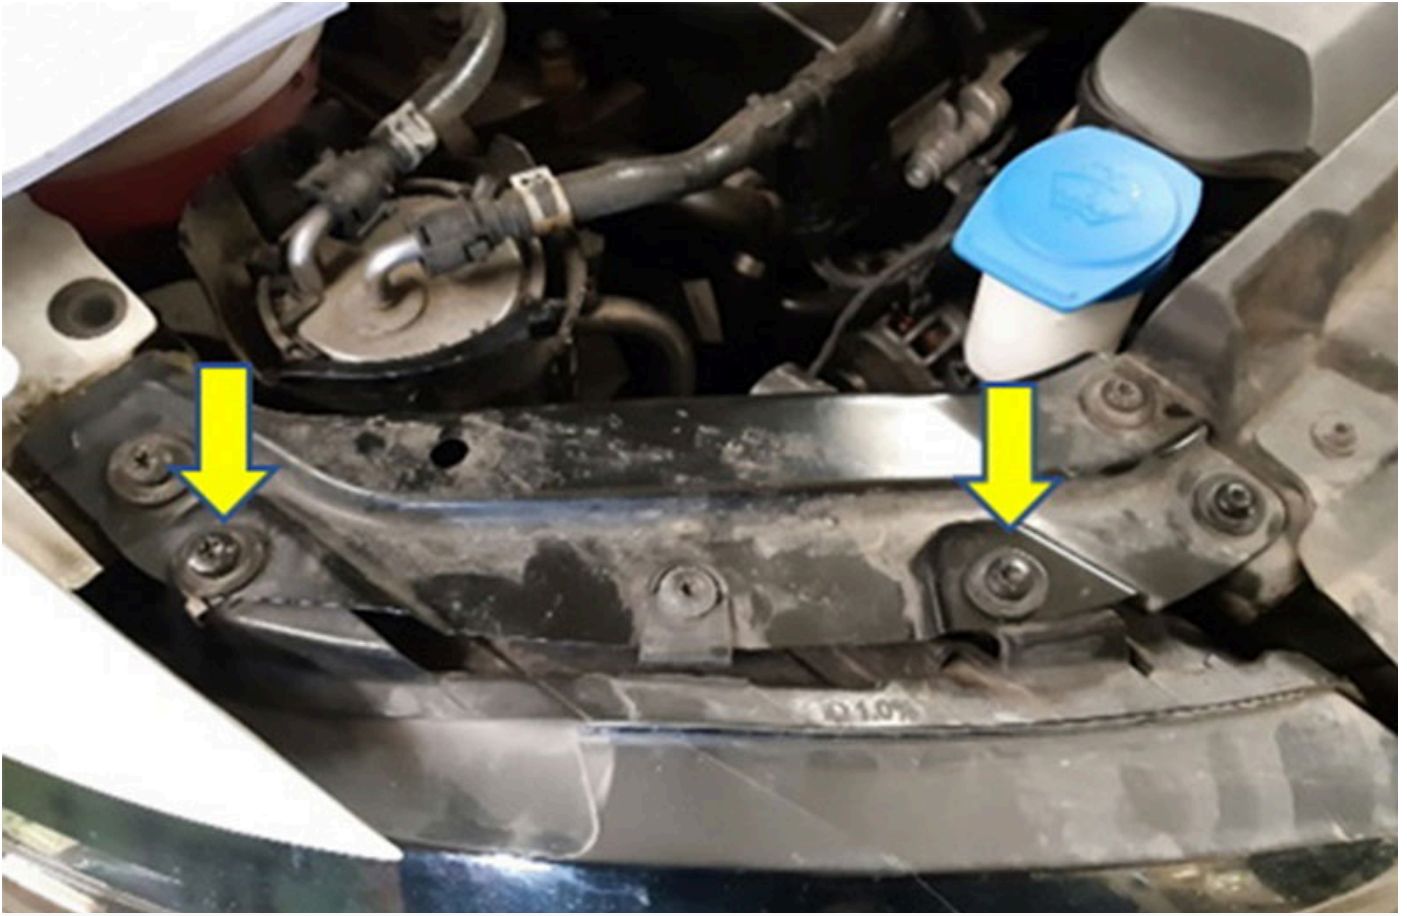

Fastening screws



Turn bulb



Remove bulb

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.