



Bulletin

Ford Galaxy VX, VY S-Max with rear spoiler Model year: 02/2006-10/2010

Brake light display faulty

In the above vehicles, "Brake light faulty" lights up on the info display.

Following a visual inspection, a defect is discovered on the third brake light (image 1).



Image 1.

The reason for this may be a break in the cable (image 2) around the cable bushing (tailgate brake light).

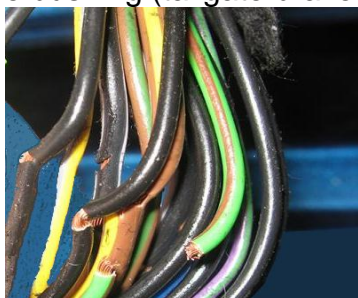


Image 2.

To remedy the problem, the cable harness should be professionally repaired or replaced.